This Service Letter reidentified as Service Bulletin M 20-28 per Service Instruction M20-15.

> MOONEY AIRCRAFT INC. SERVICE LETTER 20-28

DATE:

10-28-57

SUBJECT:

Kit - Sleeve for parburetor heat control and inspection of Fuel Line between fuel

strainer and firewall.

MODELS AFFECTED:

M-20 Serial No. 1075 thru 1156.

TIME OF COMPLIANCE: Immediately.

PARTS LIST

Rubber Tube (5 Inches Long.)

ENCLOSURE:

Compliance Card.

Two cases have occurred in which the carburetor heat control has rubbed a hole in the fuel line between fuel strainer (located in the nose wheel well) and bulkhead fitting at the firewall.

It is therefore necessary that this fuel line be inspected and replaced if necessary and that the enclosed piece of rubber tube be installed over the carburetor heat control. Slit the tube and tape in place on the control in the area where it touches the fuel line. The slit should be on the side away from the fuel line.

Please return completed compliance card.