SERVICE LETTER 20-41 SERVICE CULLETIN M.ZOW

DATE:

SUBJECT:

Inspection - Main Wheel Castings

MODELS AFFECTED:

M-20 & M-20A, ALL AIRPLANES

TIME OF COMPLIANCE:

At each 100 hour inspection

There have been several cases reported in which cracks developed in the main wheel castings. These cracks have occurred around the bearing race in the web of the outboard (or brake drum) half of the wheel. It is therefore necessary that the main wheels be closely inspected for tracks at each 100 hour inspection. The area of the wheel web around the bearing race can be readily inspected inside and out after removal of the bearings. If cracks are discovered, replace the wheel before further use.