

MOONEY AIRCRAFT, INC.

SERVICE LETTER 20-10

SERVICE BULLETIN M 20-10

DATE: 5-30-56


SUBJECT: Kit-Upper door pin striker plate.

MODELS AFFECTED: M-20 Serial No. 1002 thru 1044.

PARTS LIST: Striker Plate (1)  
Sheet Metal Screws (2)

ENCLOSURE: EO 20-10

To eliminate the possibility of excessive wear to the aluminum door frame, it is recommended that the enclosed striker plate be installed in accordance with the enclosed EO 20-10.

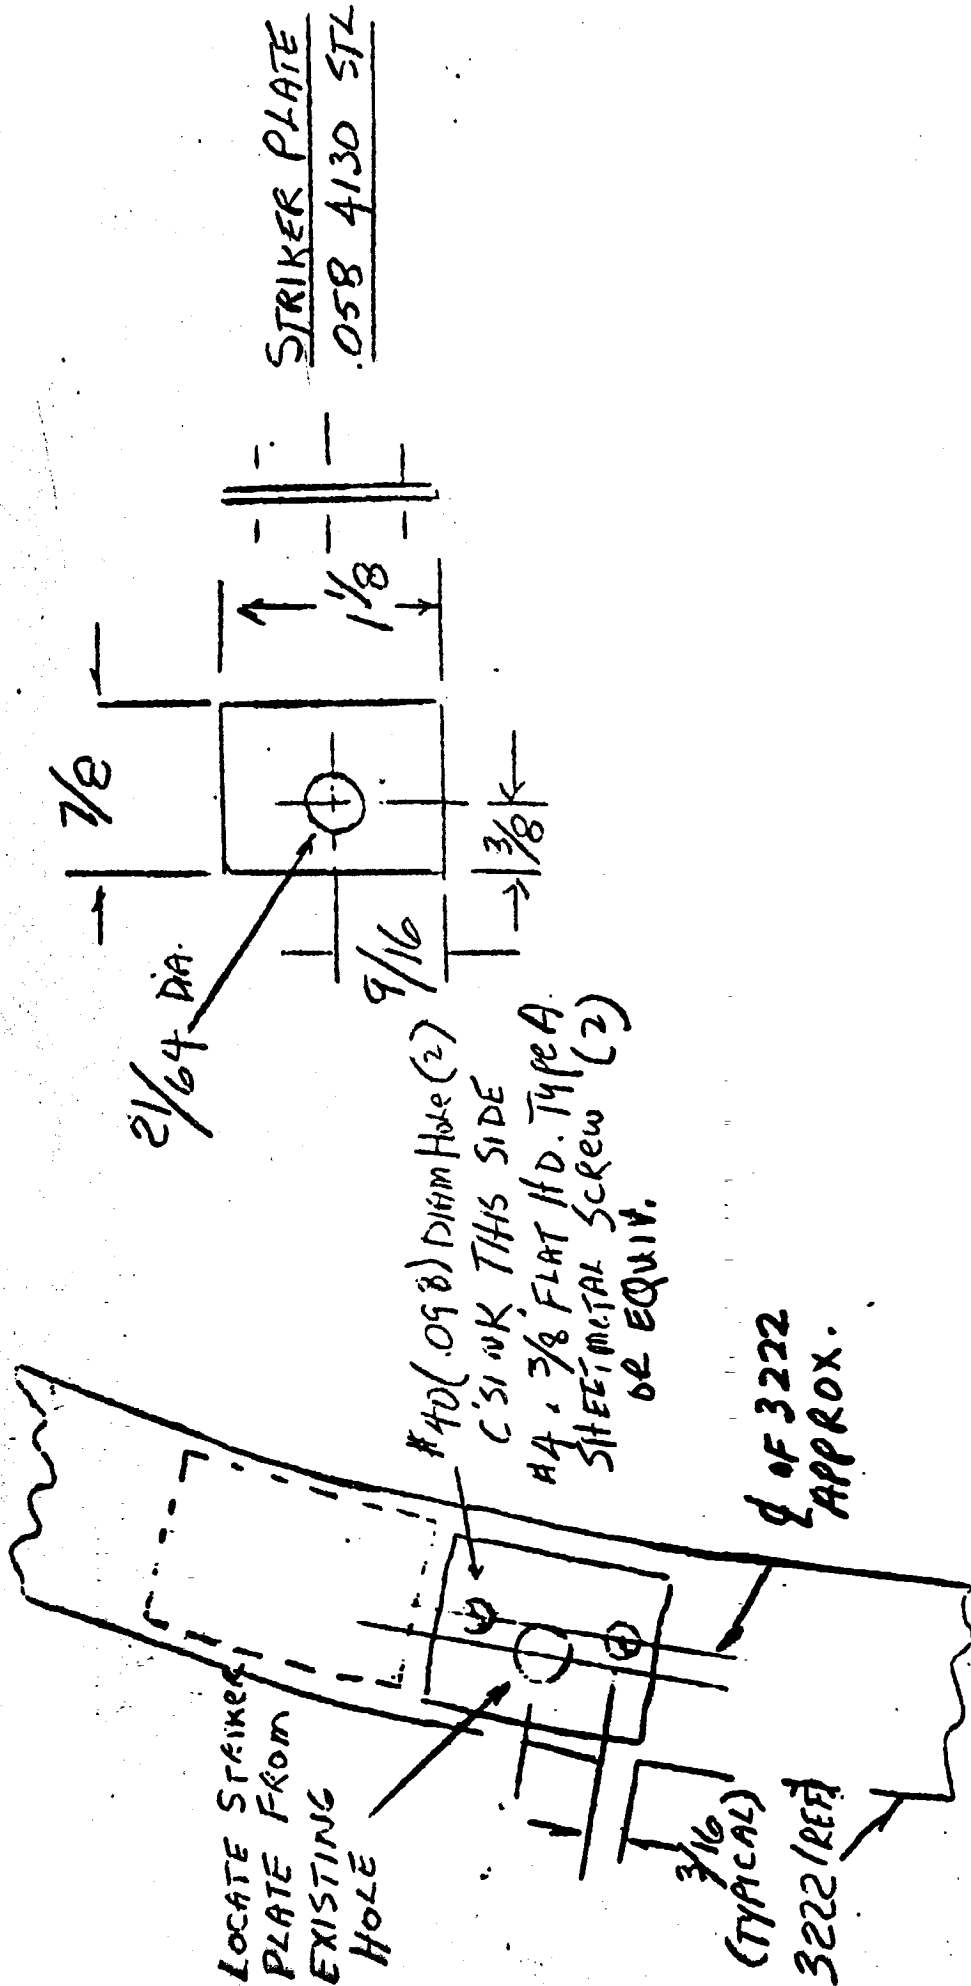

STRIKER PLATE  
058 4130 STL

VIEW LKG AFT. AT DOOR FRAME  
UPPER AFT. RETRACTABLE  
PIN HOLE

E.O. 20-10 NO DRAWING  
STRIKER PLATE INSTALL - UPPER LOCK PIN  
REASON - UPPER DOOR PIN CAUSES WEAR ON  
3222 AL BHP.  
EFF. PT. - IN PRODUCTION SERIAL NO. 10454 ON  
SERVICE LETTER 20-10 (KITS)